
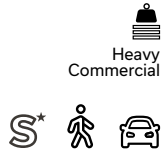


Boulevard TLI 150 Crescendo 125 Paver

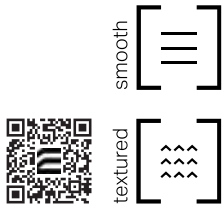

smooth	Colour	
	smooth	textured
	White - Smooth	
	Cinder Grey - Smooth	
	Charcoal - Smooth	
	Light Charcoal - Smooth	
	Black ETX - Smooth	
	Light Grey - Smooth	
	Beige Grey - Smooth	
	Beige - Smooth	
	Red - Smooth	


textured	Colour	
	smooth	textured
	Cinder Grey - Granitech	
	Light Charcoal - Granitech	
	Charcoal - Granitech	
	Light Grey - Granitech	
	Beige Grey - Granitech	
	Beige - Granitech	
	Opal White - Granitech	
	Stanstead Grey - Granitech	
	Cambrian Brown - Granitech	
	Cambrian Black - Granitech	

		Dimensions mm	Dimensions in.
A	A	150 x 125 x 333.33	5 7/8 x 4 15/16 x 13 1/8
B	B	150 x 125 x 416.67	5 7/8 x 4 15/16 x 16 3/8
C	C	150 x 125 x 458.33	5 7/8 x 4 15/16 x 18
D	D	150 x 125 x 500	5 7/8 x 4 15/16 x 19 11/16
E	E	150 x 125 x 541.67	5 7/8 x 4 15/16 x 21 5/16
F	F	150 x 125 x 583.33	5 7/8 x 4 15/16 x 23
	Cube ft ²	53.80	10.76 per row
	Cube ft ²	53.80	10.76 per row
	Cube ft ²	43.04	10.76 per row


Mass/ft ²	32.6 kg	71.7 lb
Mass/ft ²	34.4 kg	75.7 lb
Mass/ft ²	43.6 kg	95.9 lb

Units are not sold separately

Typical Row

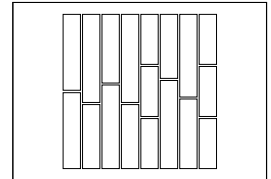

Laying Pattern

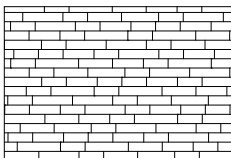

Linear

TECHNICAL INFORMATION

Product	Standard	Flexural Strength	Compressive Strength	De-icing salts freeze-thaw durability	Density	Absorption	Dimension Tolerance*
Boulevard TLI 150 Crescendo 125 Paver							
125 x 333.33							
125 x 416.67							
125 x 458.33	CSA A231.2	N/A	μ 50 MPa ≥ 45 MPa	225 g/m ² after 28 cycles 500 g/m ² after 49 cycles	N/A	N/A	Length: -1.0 to +2.0 mm Width: -1.0 to +2.0 mm Height: ±3.0 mm
125 x 500							
125 x 541.67							
125 x 583.33							

Setting of joint-filling sand: Cover the vibrating plate with a removable rubber tread (neoprene or polypropylene). Cover the snow removal tools with Teflon or neoprene protectors to minimize the risk of damage from scratches or concrete shards. Laying patterns: These laying patterns are by way of example only and represent only a few of many possibilities. Permacon shall not be responsible for the excess or shortage of pavers resulting from installation according to these laying patterns.